


Installation instructions for Herkules ERSAN 1 M

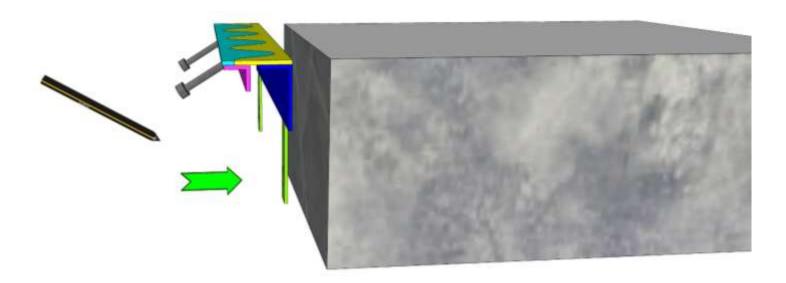


*


1. Preparing the existing concrete slab

The existing concrete slab has to be prepared in a way that makes it possible to mount the joint profile on the frontside flat and without any clearances. Verify this by holding the profile to the front side as often as necessary.

*



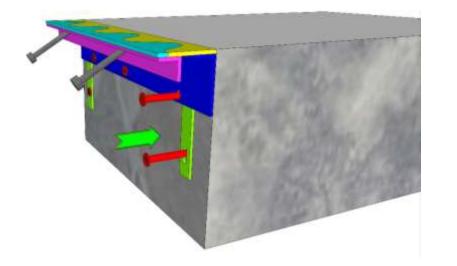

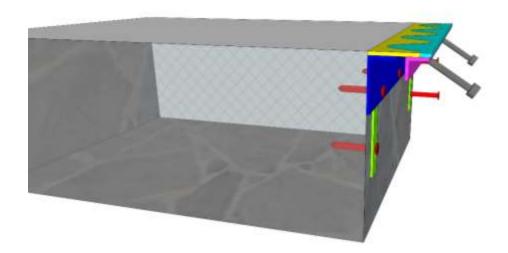

2. Levelling of the profile and fixing it to the undersurface


Cut the joint profile to the desired length with a cutting blade. With an axis longer than 3000 mm, extend the individual profile elements by using the integrated screw connections. The profile head has to be horizontal and level with the top edge of the existing foundation slab.

The mounting brackets of the profile (front side) have elongated holes. Start with fixing the profile using the appropriate screws on this front side. The elongated holes offer an additional possibility to adjust the profile to the correct height.

Afterwards, fix the top mounting brackets to the undersurface. The joint profile is now fixed to the undersurface and can be friction-locked to the existing foundation slab.

Our joint profiles require no extra fixing systems and work with all common concrete screws. Please consult with the responsible manufacturer and take into consideration the information about the building site and the local conditions. We recommend the screws by the manufacturer *HILIT* due to the easy application and many years of good experiences.




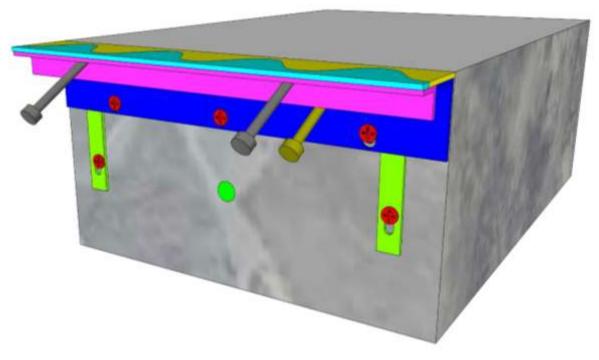

3. Load transfer doweling

Please consult with your responsible building planner / structural engineer and take into consideration the information about the building and the local conditions in order to choose the correct dimensions and positioning of the load transfer dowels.



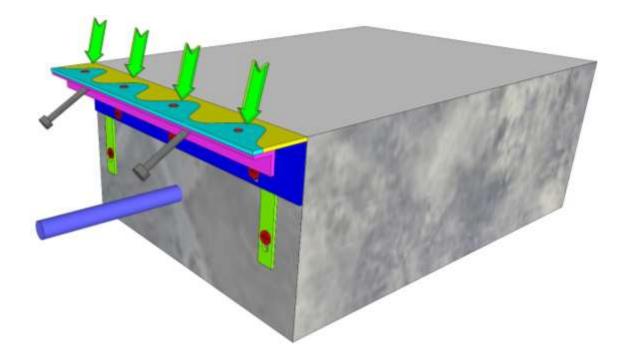

4. Casting concrete / Removal of the transport locks

It is absolutely necessary that the transport locks are only removed <u>after</u> the concrete of the new part is cast. Please remove the color-highlighted transport locks as soon as the first movement due to shrinkage begins in the new part in order to guarantee best absorption of any movement of the profile. The transport locks are never screwed back in.

*

*



5. Protecting the profile head

Please do not use adhesive tape or similar materials to protect the profile head.

Our many years of experience show that these adhesive tapes are easily damaged and torn during concrete casting, and that a quick and residue-free removal of the tape after casting the concrete is not possible. Therefore, leave the profile head without any protection during concrete casting. Practical experience shows that a light coating of the profile head with a so-called formwork oil (a concrete parting compound) before casting the concrete makes the subsequent work easier.

Any possible contaminants can always best be cleaned and visually improved immediately after the casting of the concrete, while still wet, using a rough cloth or a similar material.

Power troweling the profile head:

Please coordinate further steps with your subcontractor; never go directly over the profile heads with a power trowel or similar equipment. Any concrete coating the profile head can be damaging.

<u>Please note:</u> Our application-specific recommendations correspond with our experiences. We recommend to adjust the installation to the local conditions and refer to our general terms and conditions of sale and our delivery conditions. As a basic principle, we reject any liability claims for above mentioned instructions.

*

*